TOSHIBA

TOSHIBA BIPOLAR LINEAR INTEGRATED CIRCUIT SILICON MONOLITHIC

TA1304F,TA1304N

TV-SOUND PROCESSOR


FEATURES

Sound processor

- 2 ch inputs (L-ch, R-ch)
- 3 ch outputs (L-ch, R-ch, W-ch)
- Volume, balance, treble, bass and woofer level control
- Built-in woofer low-pass filter
- Input matrix circuit
- ALS (Automatic Level Suppressor) circuit

I/O port circuit

- 2 ch input ports
- 2 ch output ports

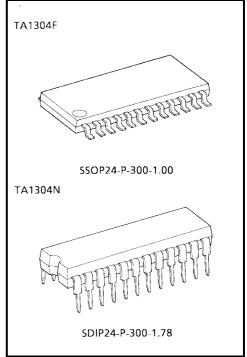

Weight:

SSOP24-P-300-1.00: 0.33 g (Typ.) SDIP24-P-300-1.78: 1.22 g (Typ.)

The information contained herein is subject to change without notice.

TOSHIBA is continually working to improve the quality and reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing TOSHIBA products, to comply with the standards of safety in making a safe design for the entire system, and to avoid situations in which a malfunction or failure of such TOSHIBA products could cause loss of human life, bodily injury or


to avoid situations in which a malfunction or failure of such TOSHIBA products could cause loss of human life, bodily injury or damage to property.

In developing your designs, please ensure that TOSHIBA products are used within specified operating ranges as set forth in the most recent TOSHIBA products specifications. Also, please keep in mind the precautions and conditions set forth in the "Handling Guide for Semiconductor Devices," or "TOSHIBA Semiconductor Reliability Handbook" etc..

The TOSHIBA products listed in this document are intended for usage in general electronics applications (computer, personal equipment, office equipment, measuring equipment, industrial robotics, domestic appliances, etc.). These TOSHIBA products are neither intended nor warranted for usage in equipment that requires extraordinarily high quality and/or reliability or a malfunction or failure of which may cause loss of human life or bodily injury ("Unintended Usage"). Unintended Usage include atomic energy control instruments, airplane or spaceship instruments, transportation instruments, traffic signal instruments, combustion control instruments, medical instruments, all types of safety devices, etc.. Unintended Usage of TOSHIBA products listed in this document shall be made at the customer's own risk shall be made at the customer's own risk.

The products described in this document are subject to the foreign exchange and foreign trade laws.
 The information contained herein is presented only as a guide for the applications of our products. No responsibility is assumed by TOSHIBA CORPORATION for any infringements of intellectual property or other rights of the third parties which may result from its use. No license is granted by implication or otherwise under any intellectual property or other rights of TOSHIBA CORPORATION or others

BLOCK DIAGRAM

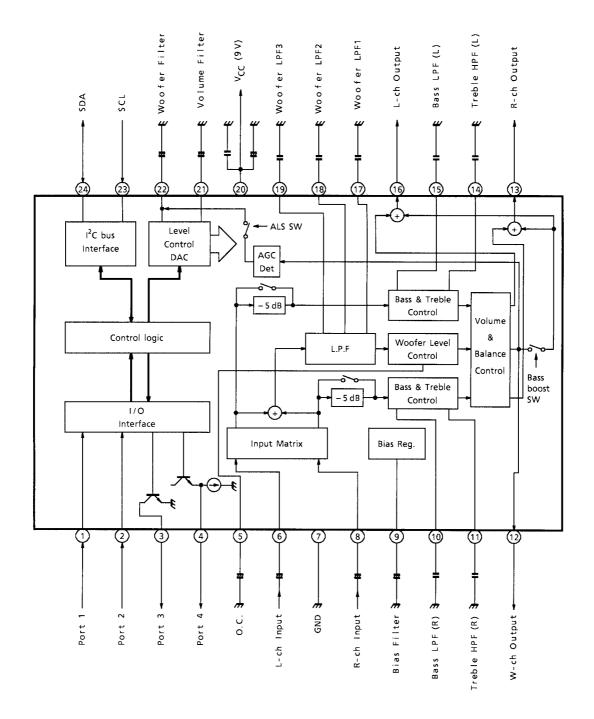

TERMINAL FUNCTION

PIN No.	NAME	FUNCTION	INTERFACE CIRCUIT
1 2	Port 1 Port 2	These are logical input terminals. Threshold voltage is 2.3 V. The input level of these terminals are read by MCU through I C bus lines.	
3	Port 3	A open collector type output controlled by MPU through I ² C bus lines. Maximum sink current is 1 mA.	20 3 100,Ω 5
4	Port 4	A emitter follower type output controlled by MPU through I ² C bus lines. This terminal can 3 level output, 0 V, 2.5 V and 5 V. Maximum souce current is 2 mA, and maximum sink current is 250 µA.	250 HAD 250 HA
5	Offset cancelling filter	DC offset cancelling filter for Woofer channel. Connect a capacitor (10 μF) between this terminal and GND.	20 30 kΩ 30 kΩ 5
6 8	L-ch input R-ch input	Audio input terminals.	24 kΩ 24 kΩ 24 kΩ 24 kΩ 27 24 kΩ 29 2 3 3 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4

PIN No.	NAME	FUNCTION	INTERFACE CIRCUIT
7	GND	GND terminal.	_
9	Bias filter	Filter for noise rejection of the bias. Connect a capacitor (4.7 μF) between this terminal and GND.	20 3 7
10 15	Bass LPF (R) Bass LPF (L)	LPFs for bass control circuits. Connect capacitors (0.027 μF) between each terminals and GND.	20 10 15 100,Ω 15 22,kΩ 22,kΩ 22,kΩ 23, Ω 23, Ω 24, Ω 24, Ω 25, Ω 26, Ω 27, Ω 28, Ω 29, Ω 20, Ω
11 14	Treble HPF (R) Treble HPF (L)	HPFs for bass control circuits. Connect capacitors (8200 pF) between each terminals and GND.	20 11 14 11 11 12 12 12 13 14 14 14 15 16 17 17 18 19 19 19 19 19 19 19 19 19 19
13 12 16	W-ch output R-ch output L-ch output	Audio output terminals. Bass boost function, addition woofer channel signal to main channel signals, is available. Using ALS (Automatic Level Suppressor), it can reduce distortion in large signal input condition.	2D C C C C C C C C C C C C C C C C C C C

PIN No.	NAME	FUNCTION	INTERFACE CIRCUIT
17 18 19	Woofer LPF 1 Woofer LPF 2 Woofer LPF 3	LPF for woofer. Connect a capacitor (0.033 μF) between terminal 17 and GND. Connect a capacitor (0.047 μF) terminal 18 and GND. Connect a capacitor (0.022 μF) terminal 19 and GND.	20 17 18 19 2 kΩ 19
20	Vcc	V _{CC} terminal. Recommended operation voltage is 9 V ± 10%.	-
21	Volume filter	Smoothing filter for volume control. Connect a capacitor (0.01 µF) between this terminal and GND.	20 Bus Control 7
22	Woofer level filter	Smoothing filter for volume control. Connect a capacitor (3.3 μ F) between this terminal and GND. This filter is also for ALS control.	20 Bus Control 7
23	SCL	SCL terminal.	23 A A E Z

PIN No.	NAME	FUNCTION	INTERFACE CIRCUIT
24	SDA	SDA terminal.	20 24 5

I²C BUS CONTROL DATA TABLE

• Slave address: 80 (h) / Write mode 81 (h) / Read mode

• Write mode address map

SUB ADDRESS	MSB	b6	b5	b4	b3	b2	b1	LSB	DEFAULT DATA
00				Bass label (Effe	ective data range	e: 0E (h) ~72 (h))))		40 (h) (Bass : Center)
01				Treble level (Effe	ective data rang	e : 0E (h) ~72 (h	n))		40 (h) (Treble : Center)
02				Volume (Effec	tive data range	: 00 (h) ~72 (h))			00 (h) (Volume : Min.)
03	TEST SW "0": Normal "1": Test	ALS SW "0": Off "1": On	"0": Off "00": 180 mV			Input att "0" : 0 dB "1" : -5 dB	Input matrix "00": Normal "01": R-ch "10": L-ch "11": Reverce		00 (h) (TEST SW : Normal ALS SW : Off ALS strat point : 150 mV input att : 0 dB Input matrix : Normal)
04			,	Woofer level (Eff	fective data ranç	ge : 00 (h) ~72 (h	1))		00 (h) (Woofer level : min.)
05				Balance (Effec	ctive data range	: 00 (h) ~7F (h))			40 (h) (Balance : Center)
06			Port 4 "00": 0.0 V "01": 2.5 V "10": 0.0 V "11": 5.0 V		Port 3 "0" : On "1" : Off				20 (h) (Port3 : On Port4 : 0.0 V)
07	Bass boost SW "0" : On "1" : Off		Woofer LPF fo "00": 100 Hz "01": 125 Hz "10": 170 Hz "11": 210 Hz			Woofer LPF defeat "0" : Off "1" : On	Mute 2 "0" : Off "1" : On	Mute 1 "0" : Off "1" : On	10 (h) (Bass boost SW : Off Woofer LPF fo : 125 Hz Mute 1 : Off Mute 2 : Off)

The bits shown gray area must be "0".



• Read mode address map

MSB	b6	b5	b4	b3	b2	b1	LSB
P.O.R	1	1	1	1	1	Port 2	Port 1

No function bits (shown gray area) are always "1".

• P.O.R (Power on reset)
"0": After read access
"1": Power on reset

• Port1, 2 "0": "High" "1": "Low"

Purchase of TOSHIBA I^2C components conveys a license under the Philips I^2C Patent Rights to use these components in an I^2C system, provided that the system conforms to the I^2C Standard Specification as define by Philips.

EXPLANATION OF THE FUNCTIONS.

(Note: (h) means hexadecimal data, (b) means binary data)

• Bass level (Sub address 00 (h))

Bass level control. Cross-over frequency is 1 kHz.

Effective control data range is 0E (h) \sim 72 (h) (100steps). Set this data to 0E (h), bass level goes to minimum level, and set this data to 72 (h), bass level goes to maximum level. Set this data to 40 (h), bass level goes to center level

Switch on default data is 40 (h).

Control range is ± 12 dB (typ.).

Treble level (Sub address 01 (h))

Treble level control. Cross-over frequency is 1 kHz.

Effective control data range is 0E (h) ~ 72 (h) (100steps). Set this data to 0E (h), treble level goes to minimum level, and set this data to 72 (h), treble level goes to maximum level. Set this data to 40 (h), treble level goes to center level.

Switch on default data is 40 (h).

Control range is ± 12 dB (typ.).

• Volume control (Sub address 02 (h))

Volume control of L-ch, R-ch, and W-ch outputs.

Effective control data range is 00 (h) ~72 (h)

Switch on default data is 00 (h).

• Woofer level control (Sub address 04 (h))

Volume control of only W-ch output.

Effective control data range is $00 \text{ (h)} \sim 72 \text{ (h)}$

Switch on default data is 00 (h).

• Balance control (Sub address 05 (h))

Balance control. Set this data to 40 (h), balance goes to center.

Effective control data range is 00 (h) $\sim 7F$ (h).

Switch on default data is 40 (h).

• Input matrix control (Sub address 03 (h) / b1~b0)

Output signal selection control.

Set these bits to 00 (b), output mode goes to normal mode (input signal of terminal 6 is outputted to terminal 16, and input signal of terminal 8 is outputted to terminal 13). Set these bits to 01 (b) output mode goes to R-ch mode (input signal of terminal 8 is outputted to terminal 13 and terminal 16). Set these bits to 10 (b) output mode goes to L-ch mode (input signal of terminal 6 is outputted to terminal 13 and terminal 16). Set these bits to 11 (b), output mode goes to reverce mode (input signal of terminal 6 is outputted to terminal 13, and input signal of terminal 8 is outputted to terminal 16).

Switch on default data is 00 (b).

TOSHIBA TA1304F/N

• Input attenuation control (Sub address 03 (h) / b2)

When this function is active, Input signals are -5 dB attenuated at input stage of L-ch and R-ch. W-ch signal isn't attenuated. So, W-ch output level is up to 8 dB from L-ch and R-ch outputs relatively. Set the bit to 0 (b), attenuation is inactive, set the bit to 1 (b), attenuation is active. Switch on default data is 0 (b).

ALS switch (Sub address 03 (h) / b6), ALS start point (Sub address 03 (h) / b5~b4)

When bass boost function (addition woofer ch signal to main ch signals) is active, output signals are distort when the signals are over the dynamic range of the circuits. ALS (\underline{A} utomatic \underline{L} evel \underline{S} uppressor) suppresses W-ch signal level under ALS strat point, reduces the distortion in large signals input condition. Set the bit (Sub address 03 (h) / b6) to 0 (b), ALS is inactive. Set the bit to 1 (b), ALS is active.

Switch on default data is 0 (b).

The bits of 03 (h) / $b5\sim b4$ set ALS start point. Set the bits to 00 (b), ALS start point is 180 mV_{rms}. Set the bits to 01 (b), ALS start point is 310 mV_{rms}. Set the bits to 10 (b), ALS start point is 430 mV_{rms}. And set the bits to 11 (b), ALS start point is 630 mV_{rms}.

Switch on default data is 00 (b).

• Test switch (Sub address 03 (h) / b7)

This bit is for IC testing. So this bit must be set to 0 (b).

Switch on default data is 0 (b).

• Port 3 control (Sub address 06 (h) / b3), Port 4 control (Sub address 06 (h) / b5~b4)

The IC, e.g. sound demltiplexer, which isn't avarailable I^2C Bus, can be controlled by I^2C Bus through TA1304F.

Port 3 is open-collector type output. Set the bit to 0 (b), port3 is on. Set the bit to 1 (b), port3 is off. Switch on default data 0 (b).

Port 4 is emitter-follower type output. It can output 3 levels. Set the bits to 00 (b) or 10 (b), port 4 outputs 0 V. Set to 01 (b), port 4 outputs 2.5 V. Set to 11 (b), port 4 outputs 5 V. Switch on default data is 00 (h).

 \bullet Mute 1 (Sub address 07 (h) / b0), Mute 2 (Sub address 07 (h) / b1)

When Mute 1 is active, all outputs are muted. Set the bit to 0 (b), Mute 1 is inactive. Set the bit to 1 (b), Mute 1 is active.

Switch on default data is 0 (b).

When Mute 2 is active, only W-ch output is muted. Set the bit to 0 (b), Mute 2 is inactive. Set the bit to 1 (b), Mute 2 is active.

Switch on default data is 0 (b).

TOSHIBA TA1304F/N

• Woofer LPF fo (Sub address 07 (h) / b5~b4)

These bits set cut off frequency (fo) of the low pass filter for W-ch.

Set the bits to 00 (b), fo is 100 Hz (-3 dB point). Set the bits to 01 (b), fo is 125 Hz. Set the bits to 10 (b), fo is 170 Hz. Set the bits to 11 (b), fo is 210 Hz.

Switch on default data is 01 (h).

• Woofer LPF defeat (Sub address 07 (h) / b3)

Set the bit to 1 (b), Woofer LPF is defeated.

This function is for IC testing. so, this bit must be set to 0 (b).

Switch on default data is 0 (b).

• Bass boost switch (Sub address 07 (h) / b7)

Bass boost function is adding W-ch signal to main channel signals. It can boost low frequency signal without woofer output.

Set the bit to 0 (b), Bass boost is inactive. Set the bit to 1 (b), bass boost is active.

Switch on default data is 0 (b).



MAXIMUM RATINGS (Ta = 25°C)

CHARACTERISTIC	SYMBOL	RATING	UNIT
Supply Voltage	V _{CC}	12	V
Power Dissipation	P _D	TA1304F: 833 (Note 1) TA1304N: 1400 (Note 2)	mW
Operating Temperature	T _{opr}	-20~75	°C
Storage Temperature	T _{stg}	− 55~150	°C
Maximum Input Voltage	V_{MAX}	V _{CC} + 0.3	V
Minimum Input voltage	V _{MIN}	GND - 0.3	V

Note 1: This value is on contion that the IC is mounted on PCB (50 mm \times 50 mm). When using the device at Ta = 25° C, decrease the power dissipation by 6.7 mW for each increase of 1° C.

Note 2: When using the device at $Ta = 25^{\circ}C$, decrease the power dissipation by 11.2 mW for each increase of 1°C.

COMMENDED SUPPLY VOLTAGE

PIN No.	PIN NAME	MIN	TYP.	MAX	UNIT
20	V _{CC}	8.1	9.0	9.9	V

ELECTRICAL CHARACTERISTICS DC current characteristics (V_{CC} = 9.0 V, Ta = 25°C)

PIN No.	PIN NAME	SYMBOL	MIN	TYP.	MAX	UNIT
20	V _{CC}	I _{CC}	22	34	45	mA

DC voltage characteristics (V_{CC} = 9.0 V, Ta = 25°C)

PIN No.	SYMBOL	TEST CIR- CUIT	TEST CONDITION	MIN	TYP.	MAX	UNIT
3	V ₃	_		_	_	0.5	
4	V ₄	_		_	_	0.5	
5	V_5	_		4.0	4.5	5.0	
6	V ₆	_		4.0	4.5	5.0	
8	V ₈	_		4.0	4.5	5.0	
9	V ₉	_		5.2	5.7	6.2	
10	V ₁₀	_		4.0	4.5	5.0	
11	V ₁₁	_		4.0	4.5	5.0	
12	V ₁₂	_	In power on defalt	4.0	4.5	5.0	V
13	V ₁₃	_	in power on detail	4.0	4.5	5.0	V
14	V ₁₄	_		4.0	4.5	5.0	
15	V ₁₅	_		4.0	4.5	5.0	
16	V ₁₆	_		4.0	4.5	5.0	
17	V ₁₇	_		4.6	5.1	5.6	
18	V ₁₈	_		4.6	5.1	5.6	
19	V ₁₉	_		4.6	5.1	5.6	
21	V ₂₁	_		_	0.0	_	
22	V ₂₂	_		0.5	1.5	2.0	

AC CHARACTERISTICS ($V_{CC} = 9.0 \text{ V}$, Ta = 25°C)

CHARACTERISTIC	SYMBOL	TEST CIR- CUIT	TEST CONDITION	MIN	TYP.	MAX	UNIT
	Go L	_		0.0	2.0	4.0	
	Go R	_		0.0	2.0	1.0	
	GoAtt L	_		-7.0	-5.0	-3.0	
Gain	GoAtt R		(Note 1)	7.0	3.0	3.0	dB
	GoBst L	_		11.0	13.0	15.0	
	GoBst R	_		11.0	10.0	10.0	
	Go W			16.0	19.0	22.0	
	THD L	_			0.03		
THD	THD R	_	(Note 2)	_	0.03	1.0	%
	THD W	_			0.2		
	SN L	_		70			
S/N	SN R	_	(Note 3)	70	_	_	dB
	SN W	_		68			
	V _{NO} L	_					
Residual Noise	V _{NO} R	_	(Note 4)	_	_	50	μV_{rms}
	V _{NO} W	_					
(10011)	Go100 L	_	A1 / =>				
Frequency Response (100 Hz)	Go100 R	_	(Note 5)	-2.0	0.0	2.0	dB
	Go10k L	_	(Nlata C)		0.0		
Frequency Response (10 kHz)	Go10k R	_	(Note 6)	-2.0	0.0	2.0	dB
	G _{LPF} 100	_	(Note 7)	4.0	6.0	8.0	- dB
	G _{LPF} 125	_		5.5	7.5	9.5	
LPF Frequency Response	G _{LPF} 170	_		4.0	6.0	8.0	
	G _{LPF} 210	_		1.0	8.0	15.0	
Balance Center	ΔG_LR	_	(Note 8)	-2.0	0.0	2.0	
	G _{BLMIN} L	_					dB
Balance Minimum	G _{BLMIN} R	_	(Note 9)	_	_	-60	
	G _{BSMAX} L	_					
Bass Maximum	G _{BSMAX} R	_	(Note 10)	10	12	14	dB
	G _{BSMIN} L	_					
Bass Minimum	G _{BSMIN} R	_	(Note 11)	-14	-12	-10	dB
	G _{TRMAX} L	_					
Treble Maximum	G _{TRMAX} R	_	(Note 12)	10	12	14	dB
	G _{TRMIN} L	_					
Treble Minimum	G _{TRMIN} R	_	(Note 13)	-14	-12	-10	dB
	G _{VLCNT} L	_					
Volume Center	G _{VLCNT} R	_	(Note 14)	-17	-15	-12	dB
· · · · · · · · · · · · · · · · · · ·	G _{VLCNT} W	 _ 	(-10	-12	uБ
	G _{VLMIN} L	_					
Volume Minimum	G _{VLMIN} R		(Note 15)	_	_	-65	dB
	G _{VLMIN} W	+	(.10.0 10)			-05	aB
Woofer Level Center			(Note 16)	-9.5	-7.5	-5.5	dB
vvoolei Level Celilei	G _{WLCNT}	_	(Note 16)	-9.5	-7.5	-5.5	uв

CHARACTERISTIC	SYMBOL	TEST CIR- CUIT	TEST CONDITION	MIN	TYP.	MAX	UNIT
ALS Start Point 0	v ALS 0	_		142	180	226	
ALS Start Point 1	v _{ALS} 1	_	(Note 17)	246	310	391	mVrms
ALS Start Point 2	v _{ALS} 2	_	(Note 17)	341	430	541	
ALS Start Point 3	v _{ALS} 3	_		500	630	794	
Cross Talk	CT _{L-R}	_	(Note 18)			-75	dB
Closs raik	CT _{R-L}	_	(Note 16)	_	_	-73	иь
	RR1 L	_					
Ripple Rejection (Volume Minimum)	RR1 R	_	(Note 19)	_	_	-30	dB
	RR1 W	_					
	RR2 L	_				00	
Ripple Rejection (Volume Maximum)	RR2 R	_	(Note 20)	_	_	-30	dB
	RR2 W	_				-25	
	v _{DOUT} L	_			6.7		
Output Dynamic Range	v _{DOUT} R	_	(Note 21)	6.0		_	V _{p-p}
	v _{DOUT} W	_					
	v _{DIN} L	_		5.5 7.0	7.0	_	
Input Dynamic Range	v _{DIN} R	_	(Note 22)		7.0		V _{p-p}
	v _{DIN} W	_		3.0	4.2		
	ΔVL	_					
DC Offset	ΔVR	_	(Note 23)	_	_	±350	mV
	ΔVW	_					
	G _{MUT} L	_					
Mute Redsisual Level	G _{MUT} R	_	(Note 24)	_	_	-70	dB
	G _{MUT} W	_					
Dott 1, 2 Love Love LVeltage	V _{INL} 1	_	(Nata 25)	1.0			\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
Port 1, 2 Low-Level Voltage	V _{INL} 2	_	(Note 25)	1.0	_	_	V
Dert 4. O. Historia	V _{INH} 1	_	(NI=4= 00)			0.5	
Port 1, 2 High-Level Voltage	V _{INH} 2	_	(Note 26)		_	3.5	V
Port 3 Low-Level Voltage	V _{3LOW}	_	(Note 27)	_	_	0.5	V
Port 4 Low-Level Voltage	V_{4LOW}	_		_	_	0.5	V
Port 4 Medium-Level Voltage	V _{4MID}	_	(Note 28)	2.0	2.5	3.0	V
Port 4 High-level Voltage	V _{4HI}	_		4.5	5.0	5.5	V

TEST CONDITION

NOTE	INPUT	MEAS.		BU	IS DA	TA (H	EXAD	ECIM	AL)		CVA	TECT METHOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
1	TP6 TP8	TP12 TP13	40	40	72	00	72	40	*	10 /	(a)	 Set data of sub address 03 (h) to 00 (h) and set data of sub address 07 (h) to 10 (h).
		TP16				04				90		 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
												 Measure amplitude of TP13 and TP16 (v13₁ mV_{rms}, v16₁ mV_{rms}).
												• Go R dB = 20 log (v13 ₁ / 500) Go L dB = 20 log (v16 ₁ / 500)
												 Set data of sub address 03 (h) to 04 (h).
												 Measure amplitude of TP13 and TP16 (v13₂ mV_{rms}, v16₂ mV_{rms}).
												• GoAtt R dB = 20 log (v13 ₂ / 13 ₁) GoAtt L dB = 20 log (v16 ₂ / 16 ₁)
												 Set data of sub address 03 (h) to 00 (h) and set data of sub address 07 (h) to 10 (h).
												 Input signal (80 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8
												 Measure amplitude of TP13 and TP16 (v13₃ mV_{rms}, v16₃ mV_{rms}).
												 Set data of sub address 07 (h) to 90 (h).
												 Measure amplitude of TP13 and TP16 (v13₄ mV_{rms}, v16₄ mV_{rms}).
												 GoBst R dB = 20 log (v13₄ / 13₃) GoBst L dB = 20 log (v16₄ / 16₃)
												 Measure amplitude of TP12 (v12 mV_{rms}).
												• Go W dB = 20 log (v12 / 125)
2	1	1	1	1	1	00	1	1	*	10	1	Input signal (1 kHz, 500 mV _{rms} , sine wave) to TP6 and TP8
												 Measure THD of TP13 and TP16 (THD R %, THD L %).
												 Input signal (80 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8.
												Measure THD of TP12 (THD W %)

	INPUT	MEAS.		BU	IS DA	TA (HI	EXAD	ECIM	AL)			
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
3	TP6 TP8	TP12 TP13	40	40	72	00	72	40	*	10	(a)	 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8
	IFO	TP16										 Measure amplitude of TP13 and TP16 (v13s mV_{rms}, v16s mV_{rms}).
												Connect TP6 and TP8 to GND.
												 Measure amplitude of TP13 and TP16 (v13n mV_{rms}, v16n mV_{rms}).
												 SN R dB = 20 log (v13_s / v13_n) SN L dB = 20 log (v16_s / v16_n)
												 Input signal (80 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8.
												 Measure amplitude of TP12 (v12_s mV_{rms}).
												Connect TP6 and TP8 to GND.
												 Measure amplitude of TP12 (v_{12n} mV_{rms}).
												• SN W dB = 20 $\log (v12_s / v12_n)$
4	_	↑	1	1	00	1	00	1	*	1	↑	Connect TP6 and TP8 to GND.
												 Measure amplitude of TP12, TP13 and TP16 (v_{NO} W μV_{rms}, v_{NO} R μV_{rms}, v_{NO} L μV_{rms}).
5	TP6 TP8	TP12 TP13	1	1	72	1	72	1	*	1	1	 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
	11 0	11 10										 Measure amplitude of TP13 and TP16 (v13_o mV_{rms}, v16_o mV_{rms}).
												 Input signal (100 Hz, 500 mV_{rms}, sine wave) to TP6 and TP8
												 Measure amplitude of TP13 and TP16(v13 mV_{rms}, v16 mV_{rms}).
												● Go100 R dB = 20 log (v13 / v13 _o) Go100 L dB = 20 log (v16 / v16 _o)
6	1	1	1	1	1	1	1	1	*	1	↑	 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
												 Measure amplitude of TP13 and TP16 (v13_o mV_{rms}, v16_o mV_{rms}).
												 Input signal (10 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
												 Measure amplitude of TP13 and TP16 (v13 mV_{rms}, v16 mV_{rms}).
												• Go10k R dB = 20 log (v13 / v13 _o)
												Go10k L dB = 20 log (v16 / v16 ₀)

NOTE	INPUT	_		В	US DA	TA (HI	EXADE	CIMA	L)	ı	SW ₁	TEST METHOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	3001	TEST METHOD
7	TP6 TP8	TP12	40	40	72	00	72	40	*	00	(a)	 Input signal (300 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8.
	110									10		 Set data of sub address 07 (h) to 00 (h).
										/ 20		 Measure amplitude of TP12 (v12₀ mV_{rms}).
										/		Set data of sub address 07 (h) to 10 (h)
										30		 Measure amplitude of TP12 (v12₁ mV_{rms}).
										/		Set data of sub address 07 (h) to 20 (h)
										14		 Measure amplitude of TP12 (v12₂ mV_{rms}).
												 Set data of sub address 07 (h) to 30 (h).
												 Measure amplitude of TP12 (v12₃ mV_{rms}).
												 Set data of sub address 07 (h) to 14 (h).
												 Measure amplitude of TP12 (v12_x mV_{rms}).
												• G _{LPF} 80 dB = 20 log (v12 ₀ / v12 ₁)
												G_{LPF} 100 dB = 20 log (v12 ₁ / v12 ₂)
												G_{LPF} 130 dB = 20 log (v12 ₂ / v12 ₃)
												G _{LPF} 160 dB = 20 log (v12 ₃ / v12 _x)
8	1	TP13 TP16	↑	↑	1	↑	1	↑	*	10	1	Input signal (1 kHz, 500 mV _{rms} , sine wave) to TP6 and TP8.
		IFIU										 Measure amplitude of TP13 and TP16 (v13 mV_{rms}, v16 mV_{rms}).
												● ΔG _{LR} dB = 20 log (v16 / v13)

NOTE	INPUT	MEAS.		BU	JS DA	TA (HI	EXAD	ECIM/	AL)		0)4/	TEST METUOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
9	TP6 TP8	TP13 TP16	40	40	72	00	72	0E /	*	10	(a)	 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
	110	11 10						72				 Set data of sub address 05 (h) to 0E (h).
												 measure amplitude of TP13 and TP16 (v13_R mV_{rms}, v16_R mV_{rms}).
												 Set data of sub address 05 (h) to 72 (h).
												 Measure amplitude of TP13 and TP16 (v13_L mV_{rms}, v16_L mV_{rms}).
												• G _{BLMIN} R dB = 20 log (v13 _R / v16 _R) G _{BLMIN} N L dB = 20 log (v16 _L / v13 _L)
10	1	1	40	↑	1	1	1	40	*	1	1	 Input signal (100 Hz, 250 mV_{rms}, sine wave) to TP6 and TP8.
			72									 Set data of sub address 00 (h) to 40 (h).
												 Measure amplitude of TP13 and TP16 (v13₀ mV_{rms}, v16₀ mV_{rms}).
												 Set data of sub address 00 (h) to 72 (h).
												 Measure amplitude of TP13 and TP16 (v13_B mV_{rms}, v16_B mV_{rms}).
												• G _{BSMAX} R dB = 20 log (v13 _B / v13 _o) G _{BSMAX} L dB = 20 log (v16 _B / v16 _o)
11	1	1	40		1	1	1	1	*	1	1	 Input signal (100 Hz, 250 mV_{rms}, sine wave) to TP6 and TP8.
			0E									 Set data of sub address 00 (h) to 40 (h).
												 Measure amplitude of TP13 and TP16 (v13₀ mV_{rms}, v16₀ mV_{rms}).
												 Set data of sub address 00 (h) to 0E (h).
												 Measure amplitude of TP13 and TP16 (v13_B mV_{rms}, v16_B mV_{rms}).
												• G _{BSMIN} R dB = 20 log (v13 _B / v13 _o) G _{BSMIN} L dB = 20 log (v16 _B / v16 _o)

Don't care

NOTE	INPUT	MEAS.		BU	JS DA	TA (HI	EXAD	ECIM	AL)		0)4/	TEST METHOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
12	TP6 TP8	TP13 TP16	40	40	72	00	72	40	*	10	(a)	 Input signal (10 kHz, 250 mV_{rms}, sine wave) to TP6 and TP8.
	160	1110		27								Set data of sub address 01 (h) to 40 (h).
												 Measure amplitude of TP13 and TP16 (v13₀ mV_{rms}, v16₀ mV_{rms}).
												 Set data of sub address 01 (h) to 72 (h).
												 Measure amplitude of TP13 and TP16 (v13_T mV_{rms}, v16_T mV_{rms}).
												• G _{TRMAX} R dB = 20 log (v13 _T / v13 ₀) G _{TRMAX} L dB = 20 log (v16 _T / v16 ₀)
13	1	1	1	40	1	1	1	1	*	1	1	 Input signal (10 kHz, 250 mV_{rms}, sine wave) to TP6 and TP8.
				0E								 Set data of sub address 01 (h) to 40 (h).
												 Measure amplitude of TP13 and TP16 (v13₀ mV_{rms}, v16₀ mV_{rms}).
												 Set data of sub address 01 (h) to 0E (h).
												 Measure amplitude of TP13 and TP16 (v13_T mV_{rms}, v16_T mV_{rms}).
												• G _{TRMIN} R dB = 20 log (v13 _T / v13 ₀) G _{TRMIN} L dB = 20 log (v16 _T / v16 ₀)

^{*:} Don't care

NOTE	INPUT	MEAS.		BU	IS DA	TA (HI	EXAD	ECIM	AL)		0)4/	TEOT METHOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
14	TP6 TP8	TP12 TP13	40	40	72 /	00	72	40	*	10	(a)	 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
	160	TP16			40							 Set data of sub address 02 (h) to 72 (h).
												 Measure amplitude of TP13 and TP16 (v13₀ mV_{rms}, v16₀ mV_{rms}).
												 Set data of sub address 02 (h) to 40 (h).
												 measure amplitude of TP13 and TP16 (v13_C mV_{rms}, v16_C mV_{rms}).
												 G_{VLCNT} R dB = 20 log (v13_C / v13₀) G_{VLCNT} L dB = 20 log (v16_C / v16₀)
												 Input signal (80 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8
												 Set data of sub address 02 (h) to 72 (h).
												 Measure amplitude of TP12 (v12₀ mV_{rms}).
												 Set data of sub address 02 (h) to 40 (h).
												 Measure amplitude of TP12 (v12_C mV_{rms}).
												 G_{VLCNT} W dB = 20 log (v12C / v12o)

NOTE	INPUT	MEAS.		BU	JS DA	TA (HI	EXAD	ECIMA	AL)		0)4/	TEST METUOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
15	TP6	TP12	40	40	72	00	72	40	*	10	(a)	 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
	TP8	TP13 TP16			/ 0E							Set data of sub address 02 (h) to 72 (h).
												 Measure amplitude of TP13 and TP16 (v13_o mV_{rms}, v16_o mV_{rms}).
												 Set data of sub address 02 (h) to 0E (h).
												 measure amplitude of TP13 and TP16 (v13_{MIN} mV_{rms}, v16_{MIN} mV_{rms}).
												 G_{VLMIN} R dB = 20 log (v13_{MIN} / v13₀) G_{VLMIN} L dB = 20 log (v16_{MIN} / v16₀)
												 Input signal (80 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8
												 Set data of sub address 02 (h) to 72 (h).
												 Measure amplitude of TP12 (v12₀ mV_{rms}).
												 Set data of sub address 02 (h) to 0E (h).
												 measure amplitude of TP12 (v12_{MIN} mV_{rms}).
												● G _{VLMIN} W dB = 20 log (v12 _{MIN} / v12 _o)
16	1	TP12	1	1	72	1	72 /	1	*	1	1	 Input signal (80 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8
							40					 Set data of sub address 04 (h) to 72 (h)
												 Measure amplitude of TP12 (v12_o mV_{rms}).
												 Set data of sub address 04 (h) to 40 (h).
												 Measure amplitude of TP12 (v12_C mV_{rms}).
												• G _{WLCNT} dB = 20 log (v12 _C / v12 ₀)

	INPUT	MEAS.		В	JS DA	TA (HI	EXADE	CIMA	L)			
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
17	TP6 TP8	TP12	40	40	72	40 /	72	40	*	10	(a)	 Input signal (80 Hz, 500 mV_{rms}, sine wave) to TP6 and TP8
	110					50						 Set data of sub address 03 (h) to C0 (h).
						/ 60						 Measure amplitude of TP12 (V_{ALS} 0 V_{p-p}).
						/						 Set data of sub address 03 (h) to D0 (h).
						70						 Measure amplitude of TP12 (V_{ALS} 1 V_{p-p}).
												 Set data of sub address 03 (h) to E0 (h).
												 Measure amplitude of TP12 (V_{ALS} 2 V_{p-p}).
												Set data of sub address 03 (h) to F0 (h).
												 Measure amplitude of TP12 (VALS 3 V_{p-p}).
18	↑	TP13	1	1	1	00	1	1	*	1	1	Connect TP8 to GND.
		TP16										 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6.
												 Measure 1 kHz spectrum of TP16 output (vTP16 dBμV).
												 Measure 1 kHz spectrum of TP13 output (vTP13 dBμV).
												● CT _{L-R} dB = vTP16 - vTP13
												Connect TP6 to GND.
												 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP8.
												 Measure 1 kHz spectrum of TP13 output (vTP13 dBµV).
												 Measure 1 kHz spectrum of TP16 output (vTP16 dBµV).
												● CT _{R-L} dB = vTP13 - vTP16
19	_	TP12 TP13	1	1	00	1	00	1	*	1	(b)	Apply 9.0 V DC and sine wave (60 Hz, 500 mV _{rms}) to V _{CC} terminal.
		TP16										 Measure amplitude of TP12, TP13 and TP16 (vTP12 mV_{rms}, vTP13 mV_{rms}, vTP16 mV_{rms}).
												• RR1 W dB = 20 log (vTP12 / 500) RR1 R dB = 20 log (vTP13 / 500) RR1 L dB = 20 log (vTP16 / 500)


NOTE	INPUT	MEAS.		В	US DA	TA (H	EXADI	CIMA	L)		0)4/	TEOT METHOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
20	_	TP12 TP13	40	40	72	00	72	40	*	10	(b)	 Apply 9.0 V DC and sine wave (60 Hz, 500 mV_{rms}) to V_{CC} terminal.
		TP16										 Measure amplitude of TP12, TP13 and TP16 (vTP12 mV_{rms}, vTP13 mV_{rms}, vTP16 mV_{rms}).
												• RR1 W dB = 20 log (vTP12 / 500) RR1 R dB = 20 log (vTP13 / 500) RR1 L dB = 20 log (vTP16 / 500)
21	TP6 TP8	TP12 TP13	72	72	1	1	1	1	*	1	(a)	 Input signal (100 Hz, sine wave) to TP6 and TP8.
	11 0	TP16										 Increase amplitude of the input signal, and measure THD of TP13 and TP16.
												 Measure amplitude of TP13 and TP16 when THD of the output is 1% (VDOUT R1 Vp-p, VOUT L1 Vp-p).
												 Input signal (10 kHz, sine wave) to TP6 and TP8.
												 Increase amplitude of the input signal, and measure THD of TP13 and TP16.
												 Measure amplitude of TP13 and TP16 when THD of the output is 1% (VDOUT R2 V_{p-p}, VDOUT L2 V_{p-p}).
												Smaller value v _{DOUT} R1 or v _{DOUT} R2 is v _{DOUT} R. Smaller value v _{DOUT} L1 or v _{DOUT} L2 is v _{DOUT} L.
												Input signal (80 Hz, sine wave) to TP6 and TP8.
												 Increase amplitude of the input signal, and measure THD of TP12.
												 Measure amplitude of TP12 when THD of the output is 1% (VDOUT W V_{p-p}).

	INPUT	MEAS.			BUS D	ATA (HE)	XADE	CIMAL)		0147	TF07.45T1.05
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
22	TP6 TP8	TP12 TP13	40	40	40	00	40	40	*	10	(a)	 Input signal (1 kHz, sine wave) to TP6 and TP8.
	160	TP16										 Increase amplitude of the input signal, and measure THD of TP13 and TP16.
												 Measure amplitude of TP13 and TP16 when THD of the output is 1% (V_{DIN} R V_{p-p}, V_{DIN} L V_{p-p}).
												 Input signal (80 Hz, sine wave) to TP6 and TP8.
												 Increase amplitude of the input signal, and measure THD of TP13 and TP16.
												 Measure amplitude of TP13 and TP16 when THD of the output is 1% (V_{DIN} W V_{p-p}).
23	_	1	1	1	72	00~03	72	1	*	00	1	Connect TP6 and TP8 to GND.
										/ 01		 Change data of sub address 03 (h) to 00 (h) ~03 (h).
										/		 Change data of sub address 07 (h) to 00 (h), 01 (h) and 02 (h).
										02		 Measure DC off set of TP12, TP13, TP16 (ΔV R mV, ΔV L mV, ΔV W mV).


NOTE	INPUT	MEAS.		BU	JS DA	TA (H	EXAD	ECIM	AL)		CVAV	TEST METHOD
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
24	TP6 TP8	TP12 TP13	40	40	72	00	72	40	*	00	(a)	 Input signal (1 kHz, 500 mV_{rms}, sine wave) to TP6 and TP8.
	170	TP16								01		 Set data of sub address 07 (h) to 00 (h).
										/ 02		 Measure amplitude of TP13 and TP16 (v13₀ mV_{rms}. v16₀ mV_{rms}).
												 Set data of sub address 07 (h) to 01 (h).
												 Measure amplitude of TP13 and TP16 (v13_{MUT} mV_{rms}, v16_{MUT} mV_{rms}).
												 G_{MUT} R dB = 20 log (v13_{MUT} / v13₀) G_{MUT} L dB = 20 log (v16_{MUT} / v16₀)
												 Input signal (80 Hz, 125 mV_{rms}, sine wave) to TP6 and TP8.
												 Set data of sub address 07 (h) to 00 (h).
												 Measure amplitude of TP12 (v12₀ mV_{rms}).
												 Set data of sub address 07 (h) to 01 (h).
												 Measure amplitude of TP12 (v12_{MUT} mV_{rms}).
												• G _{MUT} W dB = 20 log (v12 _{MUT} / v12 ₀)
25	TP1	_	*	*	*	1	*	*	*	*	1	Apply 5 V to TP1 and TP2.
	TP2											Decrease voltage of TP1, and read IC status by I ² C Bus.
												Measure voltage of TP1 when IC status is changed 00 (h) to 01 (h) (V _{INL} 1 V).
												● Apply 5 V to TP1 and TP2.
												Decrease voltage of TP2, and read IC status by I ² C Bus.
												Measure voltage of TP1 when IC status is changed 00 (h) to 02 (h) (V _{INL} 2 V).

	INPUT	MEAS.		В	US DA	TA (H	EXAD	ECIMA	L)			
NOTE	POINT	POINT	00	01	02	03	04	05	06	07	SW ₁	TEST METHOD
26	TP1 TP2	_	*	*	*	00	*	*	*	*	(a)	Apply 0 V to TP1 and apply 5 V to TP2.
	11 2											 Increase voltage of TP1, and read IC status by I²C Bus.
												 Measure voltage of TP1 when IC status is changed 01 (h) to 00 (h) (V_{INH} 1 V).
												 Apply 5 V to TP1 and apply 0 V to TP2.
												 Increase voltage of TP1, and read IC status by I²C Bus.
												 Measure voltage of TP1 when IC status is changed 02 (h) to 00 (h) (V_{INH} 2 V).
27	_	TP3	*	*	*	*	*	*	04	*	1	Measure voltage of TP3 (V _{3LOW} V).
28	_	TP4	*	*	*	00	*	*	00	*	1	Set data of 06 (h) to 00 (h).
									/ 10			 Measure voltage of TP4 (V_{4LOW} V).
									/			 Set data of 06 (h) to 10 (h).
									30			 Measure voltage of TP4 (V_{4MID} V).
												 Set data of 06 (h) to 30 (h).
												Measure voltage of TP4 (V _{4HI} V).

DC TEST CIRCUIT

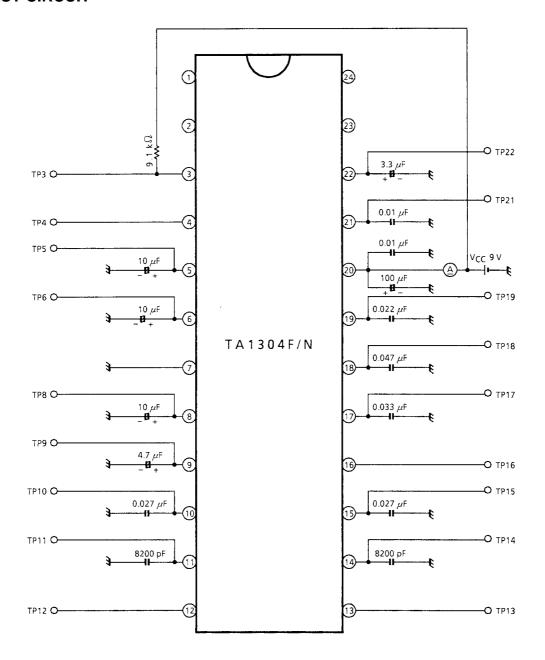


AC TEST CIRCUIT

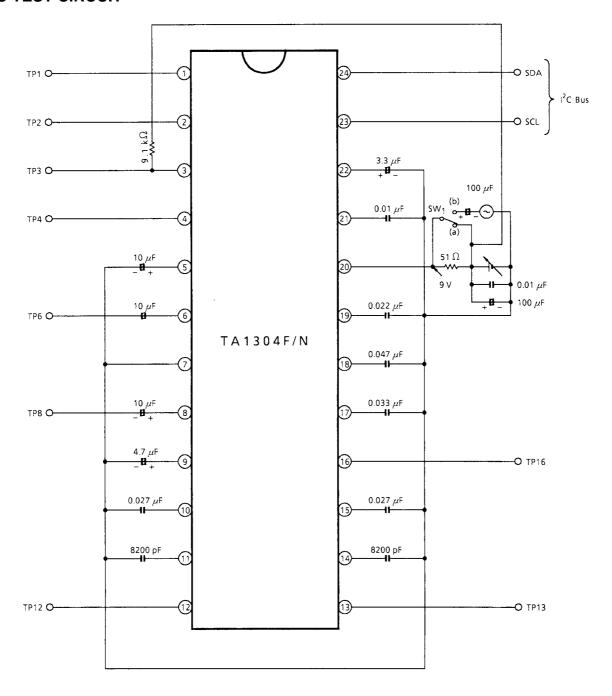





APPLICATION CIRCUIT

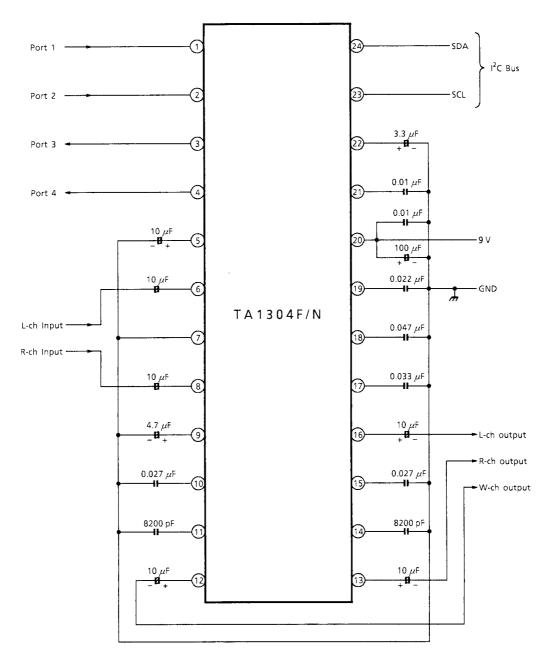



PACKAGE DIMENSIONS

SSOP24-P-300-1.00 Unit: mm

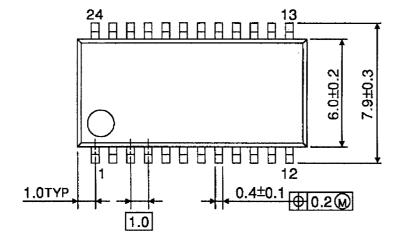



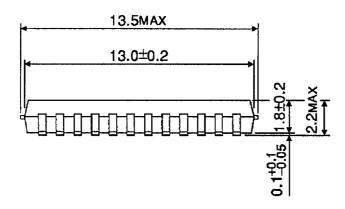


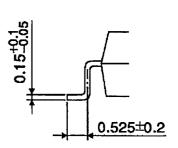

Weight: 0.33 g (Typ.)

PACKAGE DIMENSIONS

SDIP24-P-300-1.78 Unit: mm

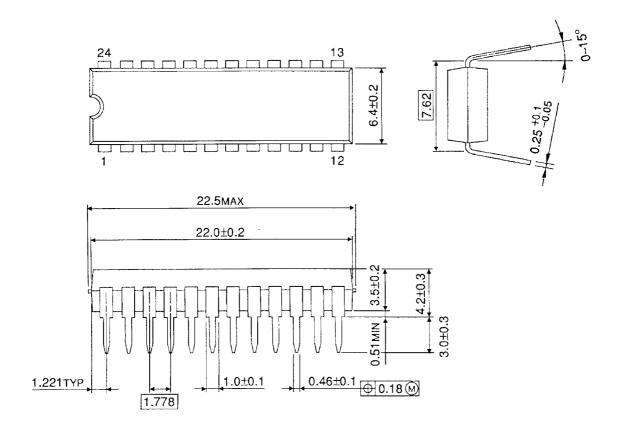

Weight: 1.22 g (Typ.)